

COVERSHEET

Planned document changes:

Briefly:

No planned changes.

Document changes:

Date:	Change:	Rev. after change:
2026-09-25	Lock cylinder updated. Machine hitch added.	C
2026-02-19	EC314 added.	B
2024-02-07	Layout/irrelevant.	A
2023-05-10	New document.	-

Readers note:



Indicates instruction.




Represents Hose.


Dashed lines for overview, mounts
on other pages/assemblies.

Std. Hitch components - S60

EC314, EC319, Machine hitch

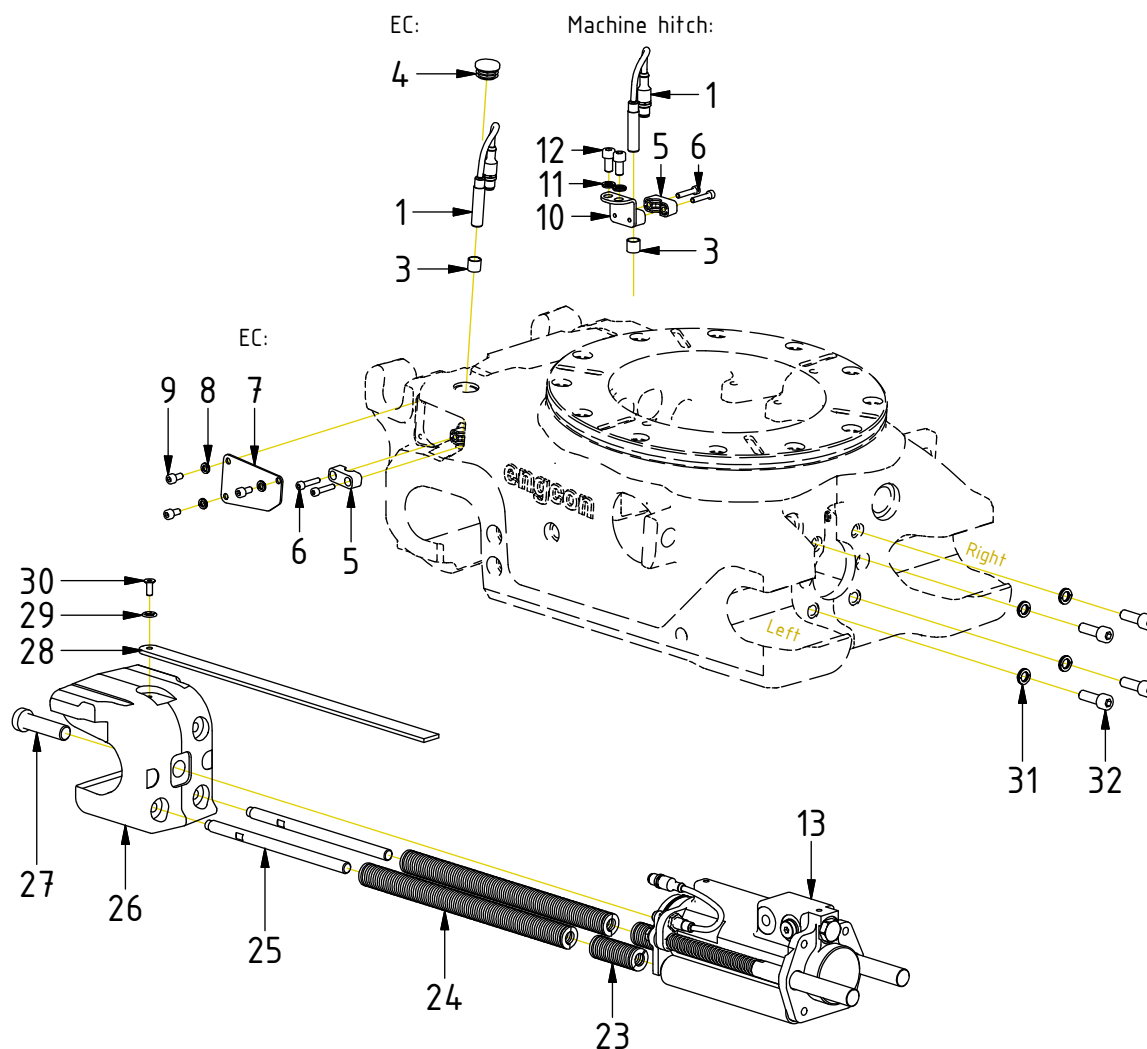


POS	DESCRIPTION	PART	QTY	COMMENTS
1	Inductive sensor QSM	1048262	2	EC: to slip ring. Machine: to Y-split
2	Hex nut			(Incl. with sensor)
3	Protection lid, inductive sensor	8000056	1	
4	Cover plug GL26	1068462	1	
5	Clamp half M12 sensor	1063793	2	
6	Screw MC6S M5x25 12.9	610402	2	
7	Small cover plate QSM60 V3 EC	1069623	2	
8	Washer NL 6mm	611039	6	
9	Screw MC6S M6x12 12.9 ZFSHL	6000352	6	
10	Sensor holder machine hitch	1074193	1	
11	Washer NL 8mm	611040	2	
12	Screw MC6S M8x16 12.9 ZFSHL	610432	2	
13	Lockcyl. QSM60 V5 Comp. Forged QSC	1083142	1	(POS.1, 14-20 incl.)
14	Lock cylinder QS60 V5 Forged	1079947	1	
15	Spring 16x175	1049973	2	
16	Ejector	1036405	2	
17	Spacer	1036406	2	
18	Sensor Plate	1036413	1	Assemble with sligth play
19	Flat Washer	611005	2	
20	Screw M6S M8x30 8,8 FZB	611538	2	Loxeal 83-52
21	Washer GBR04 1/4	710702	2	
22	Plug 1/4"	711505	2	
23	Spring 25x64	1024022	2	
24	Spring 25x305	1024021	2	
25	Steering	1025621	2	Loxeal 53-11
26	Hook V2 QS60 Cast	1046654	1	
27	Screw MLC6S M16x60 10.9	610721	1	Loxeal 83-52
28	Indicator pin QS/QSM/S 610mm	1036201	1	Cut to fit
29	Washer Starlock 6mm	6000415	1	
30	Screw MF6S M6x16 10.9 untreated	610604	1	Loxeal 83-52
31	Washer NL 10mm	611041	4	
32	Screw MC6S M10x30 12.9 ZFSHL	612018	4	

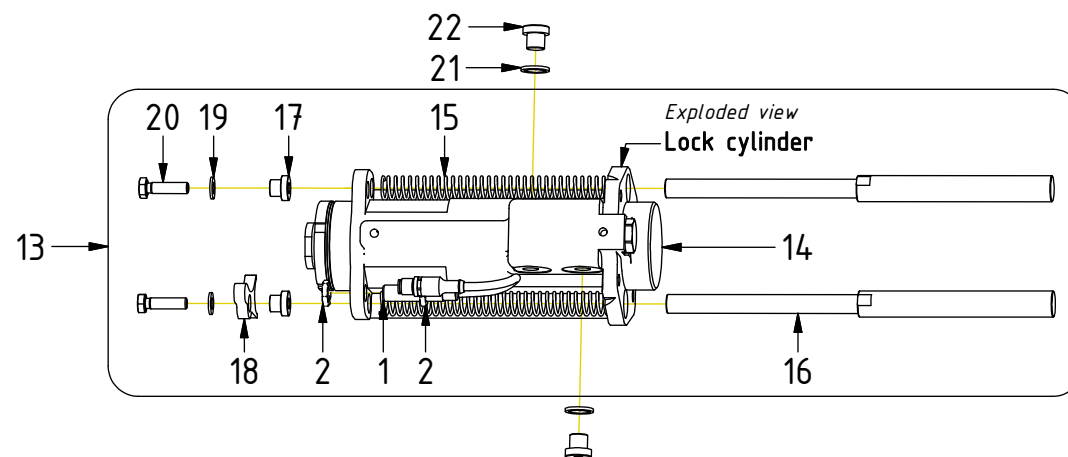

Std. Hitch components - S60


Sensor Cylinder

EC314, EC319, Machine hitch

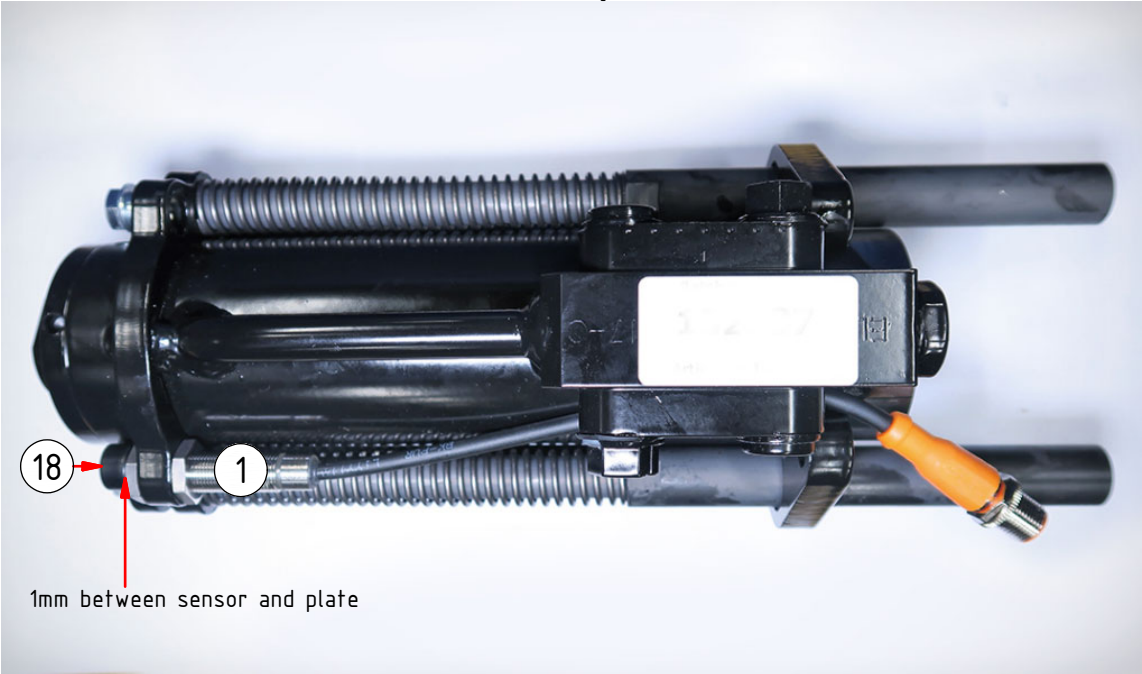

POS	DESCRIPTION	PART	QTY	COMMENTS
1	Inductive sensor QSM	1048262	2	EC: to slip ring. Machine: to Y-split
18	Sensor Plate	1036413	1	Assemble with sligth play
33	Rubber Steel Clamp Ø12	790155	1	
34	Screw MC6S 5x16 12.9	610401	1	Loxeal 55-02
35	In machine hitch sensors positions varies per control system			See "Machine hitch" for photos
● Use cable ties				

ECO Cable EC

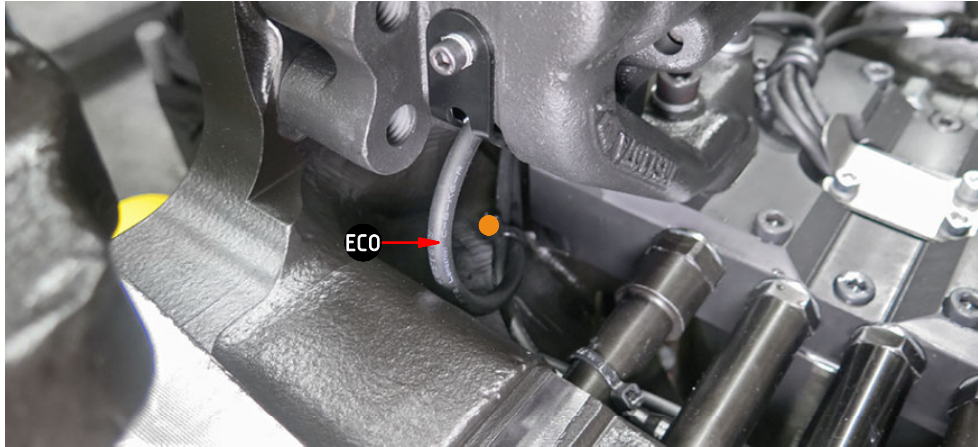

Sensor Hook EC



35

Sensor Cables

