

EC206B - ss9SQ
COVERSHEET

Planned document changes:

Briefly:
2026-01-30. POS.27 is not used. Remove from exploded view.

Document changes:


Date:	Change:	Rev. after change:
2023-10-28	New document.	-

Readers note:

 Indicates instruction.





 Represents Hose.

Dashed lines for overview, mounts
on other pages/assemblies.

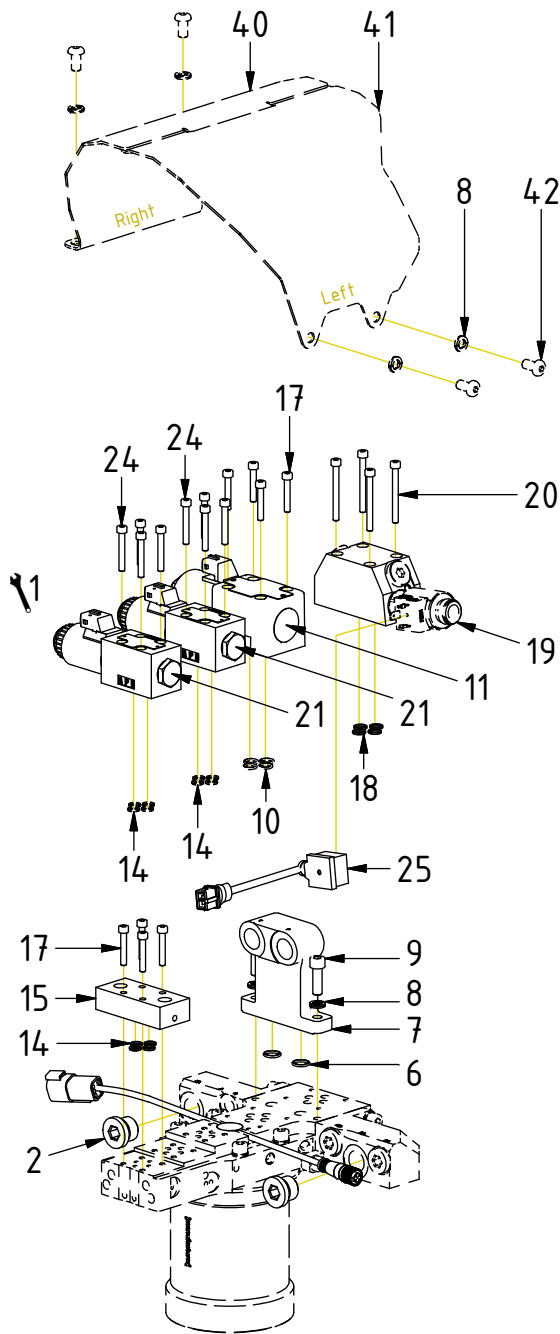


POS	DESCRIPTION	PART	QTY	COMMENTS
1	For option SG			See p.8 for instruction
2	Plug 70125-08 (1/2")	711500	2	
6	O-ring 12,42x1,78	710973	2	
7	Feed block QSM40	1061758	1	
8	Washer NL 8mm	611040	14	QTY: 4 part of make up
9	Screw MC6S M8x25 12.9 ZFSHL	6000143	2	
10	O-ring 9,25x1,78	710901	4	
11	Directional valve closed 12V	730112	1	(POS.10, 12, 13 incl.)
12	Coil 12V JT	730117	1	
13	Nut directional valve	730135	1	
14	O-ring 7,65x1,78	710960	12	
15	Connection block 2x1/4" NG4	1009586	1	
17	Screw MC6S M5x30 12.9	610403	8	Torque: 9,7Nm
18	O-ring 8,75x1,78	710959	4	
19	Dumper block 12V NG6 Complete	1026714	1	(Dump valve incl.)
20	Screw MC6S M5x50 12.9	610407	4	Torque: 9,7Nm
21	Directional valve NG4 closed 12V	730330	2	(POS.14, 22, 23 incl.)
22	Coil NG4 12V JT	730313	2	
23	Nut directional valve NG4	1006785	2	
24	Screw MC6S M5x35 12.9	610404	8	Torque: 9,7Nm
25	Adapter cabel-Hirschmann-Amp	302971	1	
40	Protective cover EC206B right	1060973	1	Part of make up
41	Protective cover EC206B left	1061668	1	Part of make up
42	Screw K6S M8x16 10.9 FZB	611810	4	Part of make up

Hoses

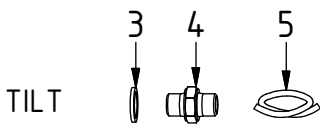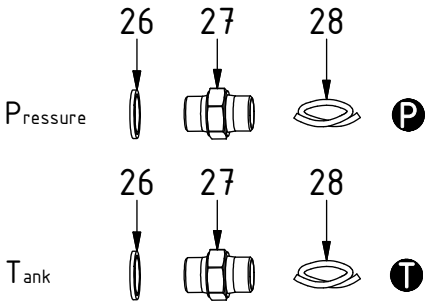

(FEED Rotation
directly between
motor & top part)



POS	DESCRIPTION	PART	QTY	COMMENTS
1	For option SG			See p.8 for instruction
3	Washer GBR04 1/4	710702	2	
4	Adapter 136-04-04 (1/4")	7000531	2	
5	Hose Tilt	7001694	2	
16	Adapter 401-04-04 90° (1/4")	710151	2	
26	Washer GBR08 1/2	710704	2	
27	Adapter 136-08-08 (1/2")	710108	2	
28	Hose Feed	7001692	2	
29	Hose feed Lock a	7001823	1	
30	Hose feed Lock b	7001824	1	
31	Hose Rotation a (ss9)	7001669	1	Part of quick hitch assy.
32	Hose Rotation b (ss9)	7001670	1	Part of quick hitch assy.

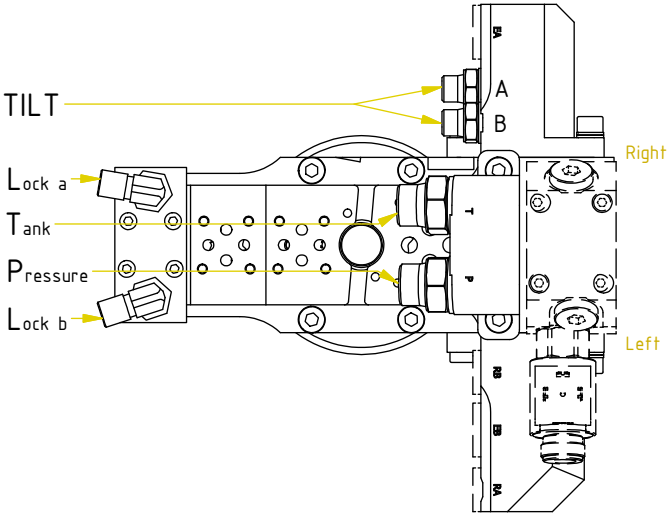


Cables

POS	DESCRIPTION	PART	QTY	COMMENTS
33	DT Jumper SQ/QSC ss9-2	1034439	1	
34	Aggregate cable ss9-2 DT Complete	8001823	1	
35	ILME cover 12P contact with jumper	810208	1	(Incl. with agg.cable)
36	Cable QS QLM tiltrotator ss9-2	842148	1	
37	Q-Safe connector			
38	Protection plate End lock EC206B	1062673	1	
39	Screw K6S M6x20 10.9 FZB	6000339	2	Torque: 8Nm


POS in order of assembly

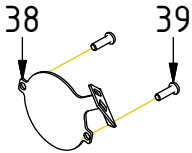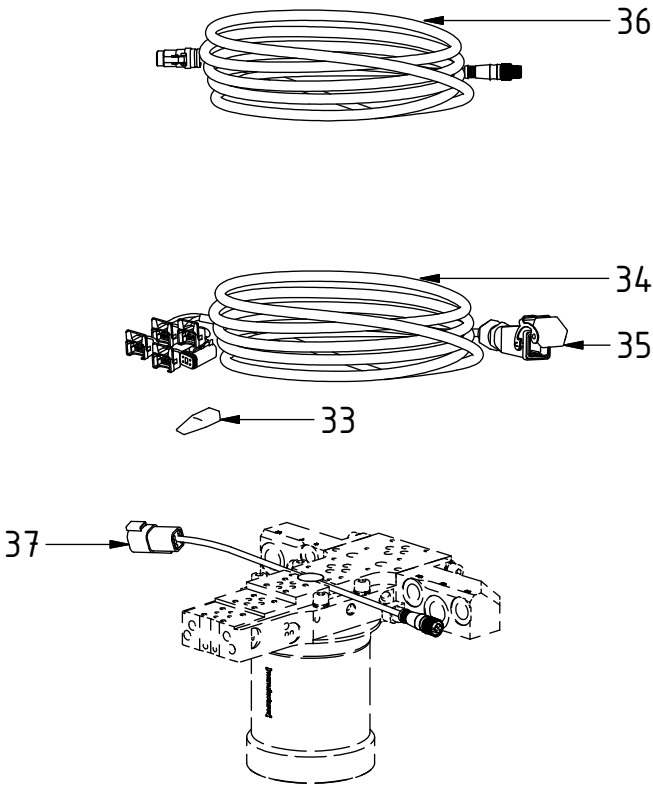

EC206BS:




Hoses
Std Feed

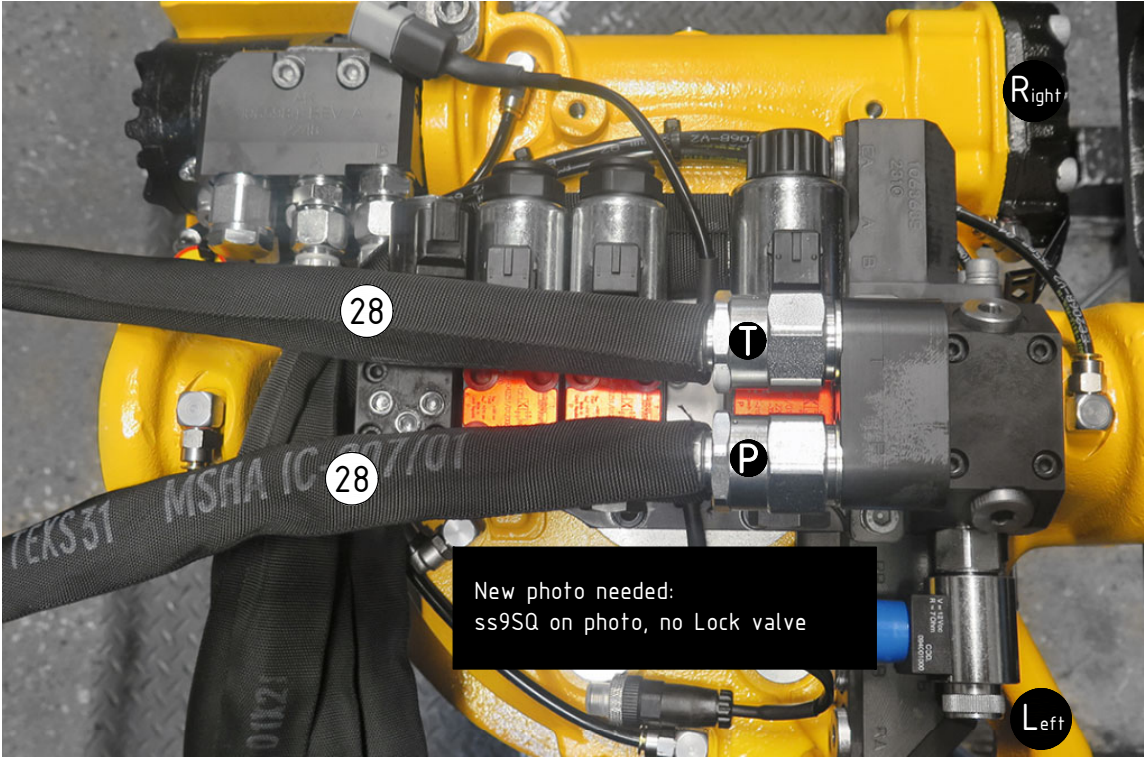

POS	DESCRIPTION	PART	QTY	COMMENTS
1	For option SG			See p.8 for instruction
5	Hose Tilt	7001694	2	
28	Hose Feed	7001692	2	
29	Hose feed Lock a	7001823	1	
30	Hose feed Lock b	7001824	1	
31	Hose Rotation a (ss9)	7001669	1	Part of quick hitch assy.
32	Hose Rotation b (ss9)	7001670	1	Part of quick hitch assy.


TILT, Rotation, Lock:

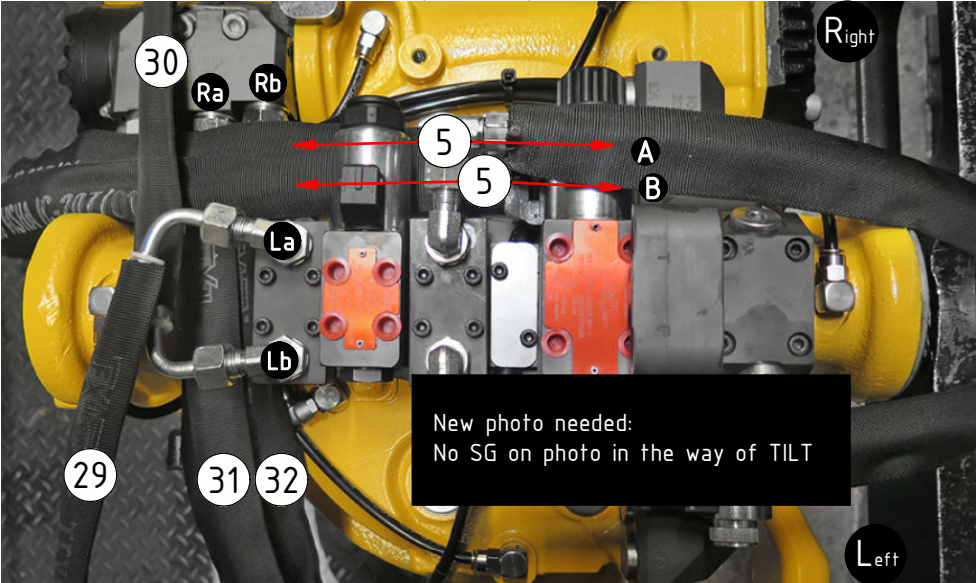

Cables

POS	DESCRIPTION	PART	QTY	COMMENTS
33	DT Jumper SQ/QSC ss9-2	1034439	1	
34	Aggregate cable ss9-2 DT Complete	8001823	1	
36	Cable QS QLM tiltrotator ss9-2	842148	1	
37	Q-Safe connector			
●	Use cable ties			



POS in order of assembly

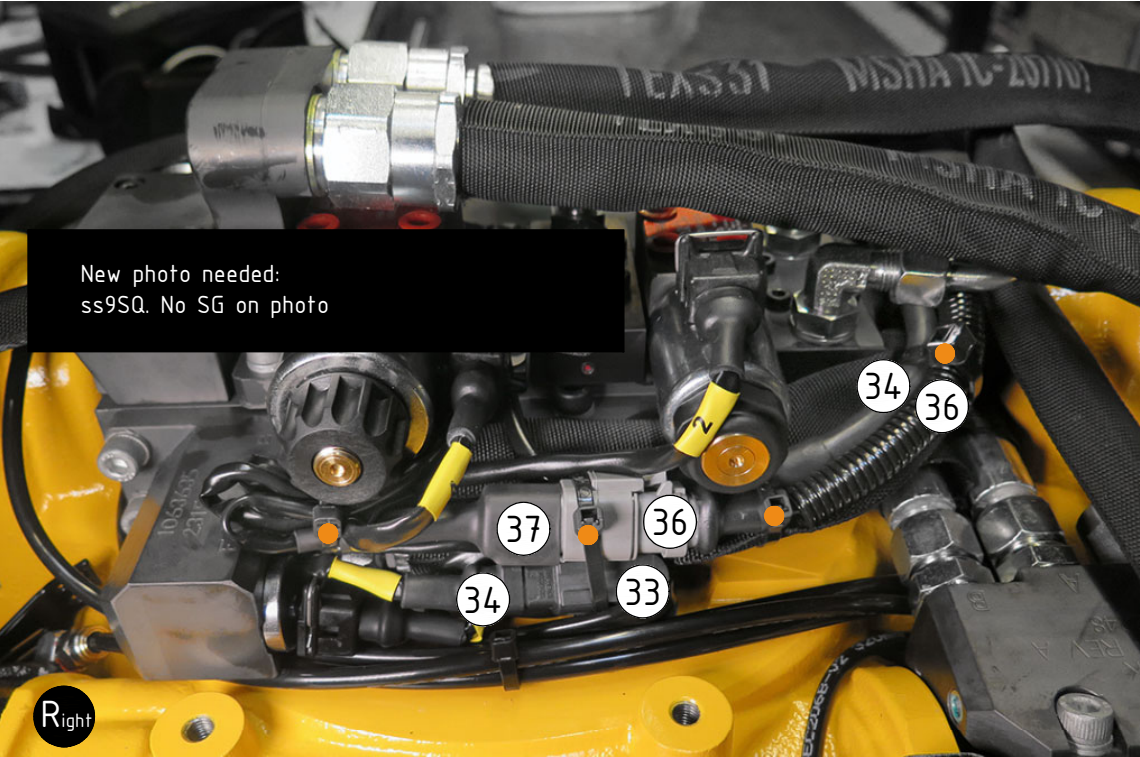

Valves

POS	DESCRIPTION	PART	QTY	COMMENTS
25	Adapter cabel-Hirschmann-Amp	302971	1	

POS in order of assembly

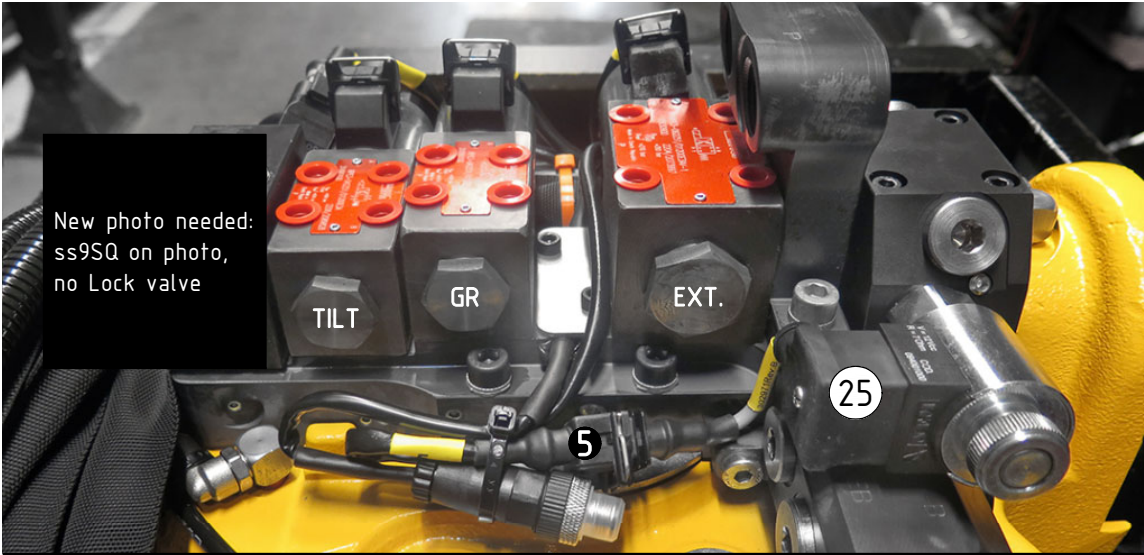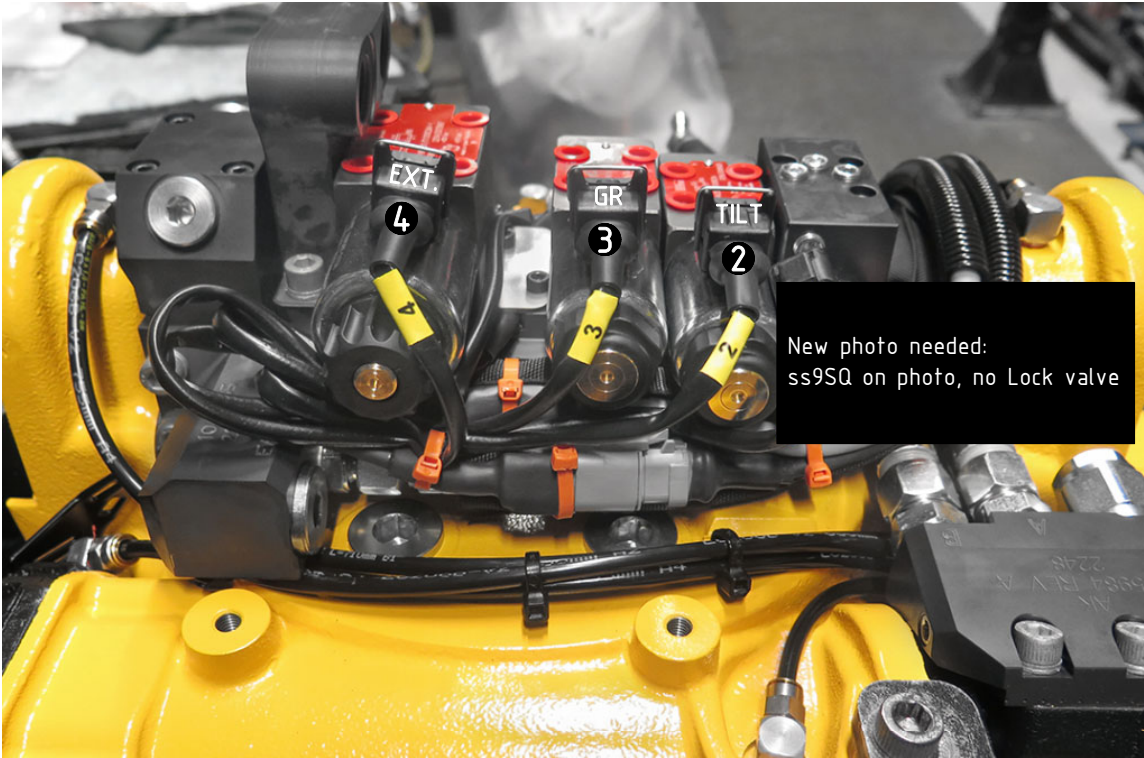

special/options

POS	DESCRIPTION	PART	QTY	COMMENTS
14	O-ring 7,65x1,78	710960	12	
15	Connection block 2x1/4" NG4	1009586	1	
16	Adapter 401-04-04 90° (1/4")	710151	2	
17	Screw MC6S M5x30 12.9	610403	8	Torque: 9,7Nm
43	Hose feed Grab a		1	
44	Hose feed Grab b		1	

POS in order of assembly

SG:

